

### Introduction Spring Charge Contact

All electrically operated (EO) ANSI/UL breakers are equipped with "Spring Charged" contacts for status indication.



### Catalog Number: GSCC1

#### Table1. Parts List

Description	Quantity
Switch with harness	1
M3 screws	2
M3 washers	2
Spacer	1
Insulation sheet	1

**DEH-41375** Installation Instructions

# EntelliGuard <sup>®</sup> G Circuit Breaker Accessories

## Spring charge Contact

WARNING: Before installing any accessories, turn the breaker OFF, disconnect it from all voltage sources, and discharge the closing spings.



AVERTISSEMENT: Avant d'installer tout accessoire, mettre le disjoncteur en position OFF, le déconnecter de toute tension d'alimentation, et décharger les resorts d'armement

Use the following procedure to install the Motor Operator accessory into the circuit breaker.

1. Check that the package contains all the parts listed in Table 1. If any components are missing, contact the Electrical Distribution Post Sales Service Team at 1-800-843-3742.

2. Turn the breaker off and discharge the closing springs by depressing the OFF and ON buttons in the sequence OFF-ON-OFF. Verify that the breaker OFF-ON indicator shows OFF on a green background and that the charge indicator shows DISCHARGE on a white background. If installing in a draw-out type breaker remove breaker from adaptor (cassette) before continuing.

3. Loosen the 6 screws on front cover (fascia) using a pozidrive screw driver as shown in Fig 1.B Rotate the charging handle down and slide the front cover over the handle to remove the front cover as shown in Fig. 1.C



Figure 1. (A) Front Cover (B) ScrewRemoval (C) Handle Rotation

4. Disconnect the input wire assembly plugs for the motor and the spring charge status indicator switch as shown in fig.7.



Figure 7. Connectors

6. Remove the M8 nylock nut from the end of the camshaft.

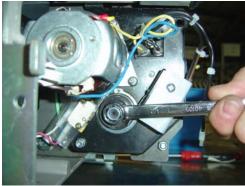


Figure 6. Nut

7. Remove the cam from the cam drive shaft.

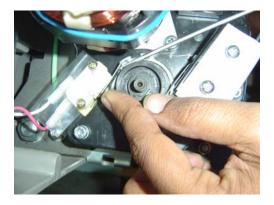


Figure 5. Motor cam

8. Take out the motor operator which is aligned on the 3 mounting holes in the side sheet by rotating it and removing three M5 bolts from the gearbox endplate.

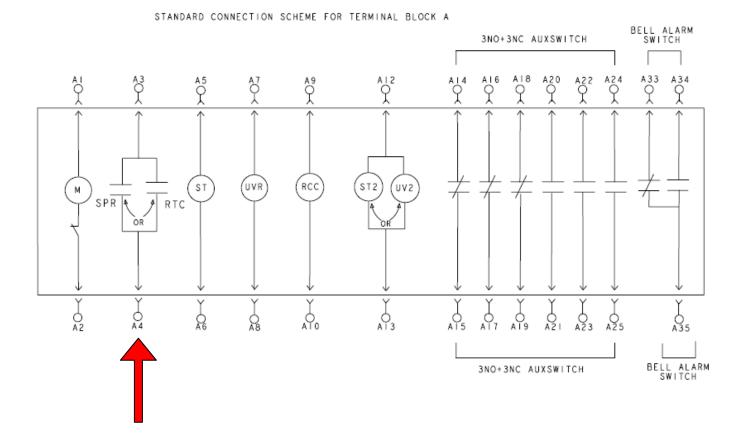


Figure 4. Screws

9. Replace the existing spring charge contact assembly with the new assembly by removing the two screws.



10. Re-assemble the motor operator. Refer DEH-41413 for the sequence of the steps.



These instructions do not purport to cover all details or variations in equipment nor, to provide contingency to be met in connection with installation, operation, or maintenance. Should further information be desired, or should particular problems arise which are not covered sufficiently for the purchaser's purposes, the matter should be referred to GE.

GE 41 Woodford Ave, Plainville, CT 06062 www.geelectrical.com

© 2009 General Electric Company



DEH-41375 R1 (04/09)